

# READ ME FIRST

## For use with CF258 series with new chip

This version of remanufactured CF258X with new chip will provide additional page yield upto 15K compare to 10K page yield @5% text coverage. Printer will display 100% toner level until consumption of toner has reach beyond 5K.

HP has added the "**Cartridge Policy**" and "**Cartridge Protection**" into their printer software to prevent compatible toner cartridge from being used. If both function are not turned off, you will get a "cartridge unrecognized", "supply memory error" or cartridge protected" message when using an aftermarket toner cartridge. Please turn off both functions on your printer before installing a new replacement toner cartridge.

### How to disable Cartridge Policy



- Step 1: Go to the main page and select "**Setup**"
- Step 2: On the Setup Menu, select "**System Setup**"
- Step 3: On the System Setup, select "**Supply Setting**"
- Step 4: On the Supply Setting, select "**Cartridge Policy**"
- Step 5: On the Cartridge Policy, select "**Off**" to disable
- Step 6: Restart the printer to complete the changes

### How to disable Cartridge Protection

- Step 1: Go to the main page and select "**Setup**"
- Step 2: On the Setup Menu, select "**System Setup**"
- Step 3: On the System Setup, select "**Supply Setting**"
- Step 4: On the Supply Setting, select "**Cartridge Policy**"
- Step 5: On the Cartridge Policy, select "**No**" to disable
- Step 6: Restart the printer to complete the changes

### Cartridge Installation

- Step 1: Make sure the power is turned on when replacing a new replacement toner cartridge
- Step 2: Install the new replacement cartridge into the printer and wait for 1-2 minutes
- Step 3: The LCD display should prompt the "**The indicated cartridge are Non-HP cartridge**" message, press **OK** to continue

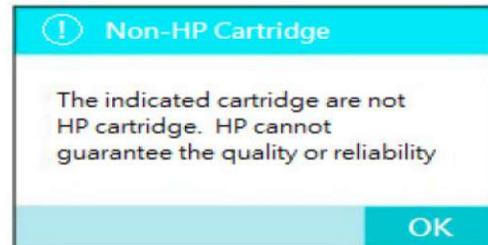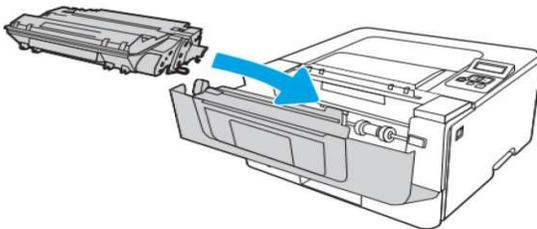

If your LCD panel display "**Even Code: 10.00.00**" and the information button is flashing, try to re-open and close the printer front cover to re-initiate the printer's toner cartridge sequence, and repeat Step 3 to clear the error message.

Often time, the OEM HP will release a new firmware update to block out the aftermarket chip solution. This is to prevent the user from enjoying the continuous saving of the aftermarket toner cartridge. To avoid such a problem from happening, it is highly recommended to disable the printer's automatic firmware update feature on your printer.

### How to disable Automatic Firmware Update on your printer

- Step 1: Go to the Main page and select "**Setup**"
- Step 2: On the Setup menu screen, select "**Service**"
- Step 3: On the Service screen, select "**LaserJet Update**"
- Step 4: On the LaserJet Update screen, select "**Manage Updates**"
- Step 5: On the Manage Update screen, select "**Check Automatically**"
- Step 6: On the Check Automatically screen, select "**Off**"
- Step 7: On the Manage Update screen, select "**Allow Updates**"
- Step 8: On the Allow Update screen, select "**No**" to continue

- The automatic firmware feature on your printer is now turned off -